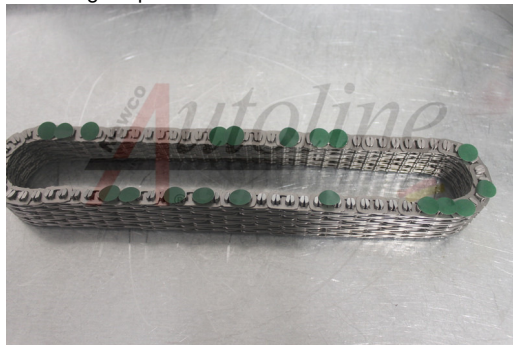
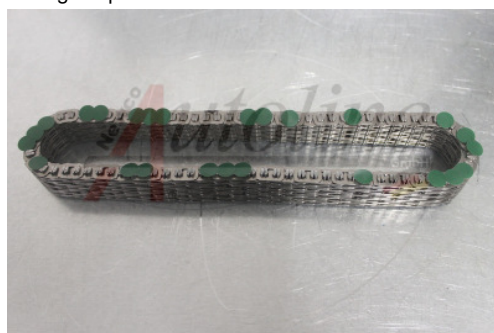


CVT Chain - **G 03 27 KE033 0101** - Original p/n 01J 331 301 BGto fit: **01J, Multitronic**

part-no. on one chain link is **01J 331 301 BG** - chain links are arranged in vertical straight rows - chain has more strings/layers (than the new design 01J 331 301 BQ) and therefore the **height is approx. 38 mm** - 75 chain link bolts - 25 links per layer - transmission codes: HHD - HHB - GWN - HSA - HHF - GYL - HEJ - HEK - HED - HDZ - HEB - HEF - JTT - JYA - JZU - JZT - KTS - JZQ - KTP - JZR - KTQ - KTN - JZP - KTK - HWK - KTJ - JZM - KTL - GYJ - KTT and probably others

CVT Chain - **G 03 27 KE033 01J0** - Original p/n 01J 331 301 BQto fit: **01J, Multitronic**

part-no. on one chain link is **01J 331 301 BQ** - chain links are arranged admixed/offset starting and ending 1-1 layers than 2-1-2-1 and so on - chain has less strings and therefore the height is less (**height: approx. 34 mm**) in comparison with the first design of 01J-chains (01J 331 301 BG) - 75 link bolts (normal distance between bolts: 3,6 mm - but **19 gaps are 6,3 mm** - due to that this chain is slightly shorter than the one for 0AW - ITS IS VERY DIFFICULT TO DIFFERENTIATE THESE TWO CHAINS - best is to check the part no. on the chain) - transmission codes: HSB - JZK - KTG - HJB and probably others

CVT Chain - **G 03 27 KE033 0AW** - Original p/n 0AW 331 301 Bto fit: **0AW, Multitronic**

part-no. on one chain link is **0AW 331 301 B** - chain links are arranged admixed/offset starting and ending 1-1 layers than 2-1-2-1 and so on - chain has less strings and therefore the **height is less approx. 34 mm** - 75 link bolts (normal distance between bolts: 3,6 mm - but **25 gaps are 6,3 mm** - due to that this chain is slightly longer than the one for 01J - ITS IS VERY DIFFICULT TO DIFFERENTIATE - best is to check the part no. on the chain)

All information in this document is given based on our knowledge of today - it might have changed or may change at any time. All data has been investigated with care, but it might have happened, that by error we received wrong details. We apologize for such cases but have to reject any responsibility if an item does not fit for the required purpose. Illustrations can deviate in exceptional cases from the actual product.

If you have more or other Information – please let us know, so that we can update this document.